

Inspection Report

Jose Mejia

Property Address:

1782 S W Advana St. Port Saint Lucie FL 34953





Home Inspection Pros T C Inc.

Roger Bayless HI5368 4253 S W Callicoe St. Port Saint Lucie, FL, 34953 772 267-1938

Table of Contents

Cover Page	<u>1</u>
Table of Contents	2
Intro Page	3
1 Roofing	4
2 Exterior	8
3 Garage	13
4 Attic	15
5 Bathrooms	16
6 Kitchen	20
7 Interiors	23
8 Foundation / Slab	25
9 Electrical System	26
10 Cooling System	29
11 Plumbing System	32
12 Hot Water Supply	35
General Summary	37
Invoice	39
Back Page	40

Date: 9/22/2014	Time: 12:00 PM	Report ID: 0147
Property: 1782 S W Advana St. Port Saint Lucie FL 34953	Customer: Jose Mejia	Real Estate Professional: Vicky Valdez

Comment Key or Definitions

The following definitions of comment descriptions represent this inspection report. All comments by the inspector should be considered before purchasing this home. Any recommendations by the inspector to repair or replace suggests a second opinion or further inspection by a qualified contractor. All costs associated with further inspection fees and repair or replacement of item, component or unit should be considered before you purchase the property.

<u>Inspected (IN)</u> = I visually observed the item, component or unit and if no other comments were made then it appeared to be functioning as intended allowing for normal wear and tear.

Not Inspected (NI)= I did not inspect this item, component or unit and made no representations of whether or not it was functioning as intended and will state a reason for not inspecting.

Not Present (NP) = This item, component or unit is not in this home or building.

Repair or Replace (RR) = The item, component or unit is not functioning as intended, or needs further inspection by a qualified contractor. Items, components or units that can be repaired to satisfactory condition may not need replacement.

People present: Customer, Agent	Type of building: Single Family (1 story)	Approximate age of building: 8 years
Temperature: 90 (F)	Weather: Cloudy	Ground/Soil surface condition: Dry
Rain in last 3 days: Yes	Radon Test: No	Water Test: No

1782 S W Advana St. Page 3 of 40

1. Roofing

The home inspector shall observe: Roof covering; Roof drainage systems; Flashings; Skylights, chimneys, and roof penetrations; and Signs of leaks or abnormal condensation on building components. The home inspector shall: Describe the type of roof covering materials; and Report the methods used to observe the roofing. The home inspector is not required to: Walk on the roofing; or Observe attached accessories including but not limited to solar systems, antennae, and lightning arrestors.

Styles & Materials

Roof Covering: Viewed roof covering from: Sky Light(s):

Architectural Walked roof None

Chimney (exterior): Estimated Age: Life Expectancy:

N/A 8 Years 20 to 25 Years

Items

1.0 Roofing system

Comments: Inspected

1.1 Roof #2

Comments: Not Present

1.2 Flashings

Comments: Not Present

1.3 Fascias and soffits

Comments: Inspected

1.4 Skylights, Chimneys and Roof Penetrations

Comments: Not Present

1.5 Roof Drainage Systems

Comments: Repair or Replace

Rated repair or replace due to extensions needed to move water away from house footings. Recommend qualified person repair as needed.

1.6 Roof ventilation systems

Comments: Inspected

1.7 Aluminum roof

Comments: Not Present

1.8 Plumbing stacks


Comments: Inspected

1782 S W Advana St. Page 4 of 40



1782 S W Advana St. Page 5 of 40



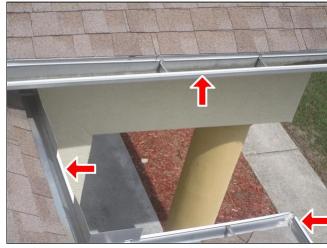

1.5 Item 5(Picture)

1.5 Item 6(Picture)



1.6 Item 1(Picture)

1.6 Item 2(Picture)

1782 S W Advana St. Page 6 of 40





1.6 Item 3(Picture)

1.8 Item 1(Picture)



1.8 Item 2(Picture)

The roof of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Roof coverings and skylights can appear to be leak proof during inspection and weather conditions. Our inspection makes an attempt to find a leak but sometimes cannot. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

Page 7 of 40 1782 S W Advana St.

2. Exterior



The home inspector shall observe: Wall cladding, flashings, and trim; Entryway doors and a representative number of windows; Garage door operators; Decks, balconies, stoops, steps, areaways, porches and applicable railings; Eaves, soffits, and fascias; and Vegetation, grading, drainage, driveways, patios, walkways, and retaining walls with respect to their effect on the condition of the building. The home inspector shall: Describe wall cladding materials; Operate all entryway doors and a representative number of windows; Operate garage doors manually or by using permanently installed controls for any garage door operator; Report whether or not any garage door operator will automatically reverse or stop when meeting reasonable resistance during closing; and Probe exterior wood components where deterioration is suspected. The home inspector is not required to observe: Storm windows, storm doors, screening, shutters, awnings, and similar seasonal accessories; Fences; Presence of safety glazing in doors and windows; Garage door operator remote control transmitters; Geological conditions; Soil conditions; Recreational facilities (including spas, saunas, steam baths, swimming pools, tennis courts, playground equipment, and other exercise, entertainment, or athletic facilities); Detached buildings or structures; or Presence or condition of buried fuel storage tanks. The home inspector is not required to: Move personal items, panels, furniture, equipment, plant life, soil, snow, ice or debris that obstructs access or visibility.

Styles & Materials

Siding Type: Construction Material: Exterior Entry Doors:

Cement stucco Masonry Metal

Driveway: Walkways: Porch/ Deck:

Concrete Concrete Screened w/ Concrete Floor

Front Rear

Glazed opening Protection:

Partial Coverage

Panels

Items

2.0 Siding

Comments: Inspected

2.1 Driveway and walkways

Comments: Inspected

2.2 Doors (Exterior)

Comments: Repair or Replace

Rated repair or replace due to rear bath door trim needs to be sealed and repaired due to water damage. Recommend qualified person repair as needed.

2.3 Windows

Comments: Repair or Replace

Seal around windows to prevent water penetrating around window frames. Recommend qualified person repair as needed.

2.4 Deck(s)

Comments: Not Present

2.5 Retaining walls

Comments: Not Present

2.6 Porch(s)

Comments: Inspected, Repair or Replace

Rated repair or replace due to ceiling of rear porch has area that needs patching. Recommend qualified person repair as needed.

2.7 Balconies

Comments: Not Present

2.8 Railings

Comments: Not Present

1782 S W Advana St. Page 8 of 40



2.0 Item 1(Picture)

2.0 Item 2(Picture)



2.1 Item 1(Picture)



2.1 Item 2(Picture)



2.2 Item 1(Picture)


2.2 Item 2(Picture)

1782 S W Advana St. Page 9 of 40





2.2 Item 3(Picture)

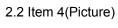





2.2 Item 5(Picture)

2.2 Item 6(Picture)







2.2 Item 7(Picture)

2.3 Item 1(Picture)

1782 S W Advana St. Page 10 of 40



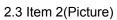

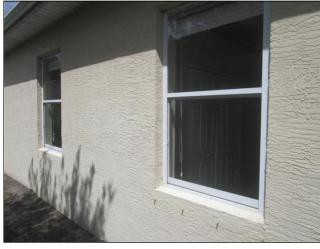


2.3 Item 3(Picture)



2.3 Item 4(Picture)



2.3 Item 5(Picture)

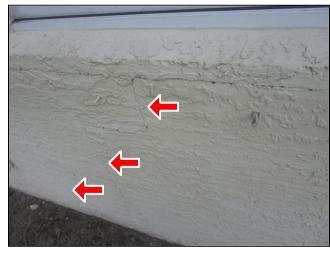

2.3 Item 6(Picture)



2.3 Item 7(Picture)


1782 S W Advana St. Page 11 of 40





2.3 Item 8(Picture)


2.3 Item 9(Picture)

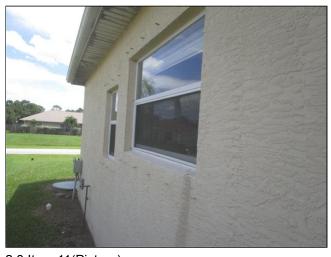

2.3 Item 10(Picture)



2.3 Item 11(Picture)

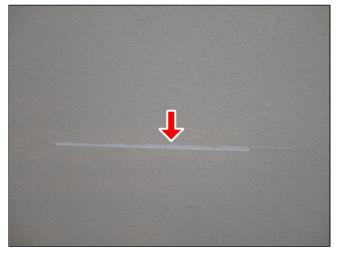

2.6 Item 1(Picture)

2.6 Item 2(Picture)

The exterior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 12 of 40

3. Garage

Styles & Materials

Garage Door Type: Garage Door Material: Auto-opener Manufacturer:

One manual Metal N/A

Slab floor: Gage Description:

Typical cracks Attached Masonry

Drywall ceiling and Wall

Solid Core

Items

3.0 Garage Ceilings

Comments: Inspected

3.1 Garage Walls (including Firewall Separation)

Comments: Inspected

3.2 Garage Floor

Comments: Inspected

3.3 Garage Door (s)

Comments: Inspected

3.4 Occupant Door (from garage to inside of home)

Comments: Inspected

3.5 Garage Door Operators (Report whether or not doors will reverse when met with resistance)

Comments: Not Present

1782 S W Advana St. Page 13 of 40





3.2 Item 1(Picture)

3.3 Item 1(Picture)





3.3 Item 2(Picture)

3.3 Item 3(Picture)

Page 14 of 40 1782 S W Advana St.

4. Attic

Styles & Materials

Attic:

Multiple Areas

Scuttle Hatch

Entered

Roof Construction:

Wood Trusses

Plywood

Insulation:

Loose Fill

Cellulose

6 to 8 Inches

None apperant

Vent Provisions:

Roof and Soffit

Items

4.0 Entered

Comments: Inspected

4.1 scuttle hatch

Comments: Inspected

4.2 Pull down stairs

Comments: Not Present

4.3 Insulation

Comments: Inspected

4.4 Framing

Comments: Inspected

4.5 Sheathing

Comments: Inspected

4.6 Ventilation


Comments: Inspected

4.7 Electrical wireing

Comments: Inspected

Section Photos



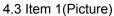



4.4 Item 1(Picture)

1782 S W Advana St. Page 15 of 40

5. Bathrooms

Styles & Materials

Bathroom #1: Bathroom #2:

Full Full Master Bedroom Hallway

Ceiling Exhaust Ceiling Exhaust

Items

5.0 Bathroom #1

Comments:

5.1 Sinks

Comments: Inspected

5.2 toilet

Comments: Inspected

5.3 Bathtub

Comments: Repair or Replace

Tub stopper missing. Recommend qualified person repair as needed.

5.4 Shower stall

Comments: Inspected
5.5 Surrounds/enclorure
Comments: Inspected

5.6 Wall tile

Comments: Inspected

5.7 Flooring

Comments: Inspected

5.8 Walls/ceiling

Comments: Inspected

5.9 Bathroom #2

Comments:

5.10 Sinks

Comments: Inspected

5.11 Toilet

Comments: Inspected

5.12 Bathtub

Comments: Inspected

5.13 Shower stall

Comments: Not Present

5.14 Wall Tile

Comments: Inspected

5.15 Flooring

Comments: Inspected

5.16 Walls/ceiling

Comments: Inspected

1782 S W Advana St. Page 16 of 40



5.1 Item 1(Picture)




5.2 Item 1(Picture)



5.3 Item 1(Picture)



5.3 Item 2(Picture)

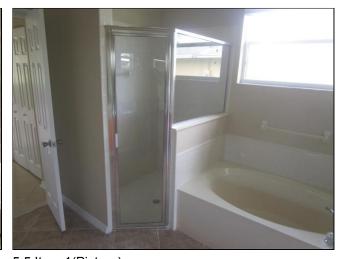

5.4 Item 1(Picture)

5.5 Item 1(Picture)

1782 S W Advana St. Page 17 of 40





5.6 Item 1(Picture)

5.7 Item 1(Picture)





5.10 Item 1(Picture)

5.11 Item 1(Picture)





5.12 Item 1(Picture)

5.12 Item 2(Picture)

1782 S W Advana St. Page 18 of 40





5.12 Item 3(Picture)

5.14 Item 1(Picture)



5.15 Item 1(Picture)

1782 S W Advana St. Page 19 of 40

6. Kitchen

Styles & Materials

Range: Ventilator/Microwave: Dishwasher:

Electric Electric Whirlpool
Amana Whirlpool 1 Year

1 Year

Refrigerator:Garbage Disposal:Compactor:WhirlpoolUNKNOWNNONE

8 Years

Items

6.0 Sink

Comments: Repair or Replace

Rated repair or replace due to disposal is not functioning and is stopping drainage of left sink. Recommend qualified person replace as needed.

6.1 Ventilator/microwave

Comments: Inspected

6.2 Dishwasher

Comments: Inspected

6.3 Range

Comments: Inspected

6.4 Refrigerator

Comments: Inspected

6.5 Floor

Comments: Inspected

6.6 ceiling

Comments: Inspected

6.7 walls

Comments: Inspected


6.8 Cabinetry

Comments: Inspected

1782 S W Advana St. Page 20 of 40



6.0 Item 1(Picture)

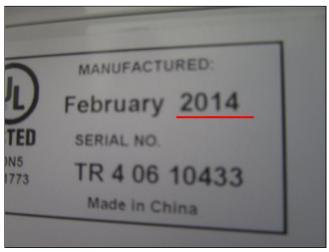

6.1 Item 1(Picture)



6.1 Item 2(Picture)



6.3 Item 1(Picture)



6.3 Item 2(Picture)



6.4 Item 1(Picture)

1782 S W Advana St. Page 21 of 40



6.4 Item 2(Picture)



6.8 Item 1(Picture)



6.8 Item 2(Picture)



6.8 Item 3(Picture)

1782 S W Advana St. Page 22 of 40

7. Interiors

The home inspector shall observe: Walls, ceiling, and floors; Steps, stairways, balconies, and railings; Counters and a representative number of installed cabinets; and A representative number of doors and windows. The home inspector shall: Operate a representative number of windows and interior doors; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to observe: Paint, wallpaper, and other finish treatments on the interior walls, ceilings, and floors; Carpeting; or Draperies, blinds, or other window treatments.

Styles & Materials

Ceiling Materials:Wall Material:Floor Covering(s):Gypsum BoardGypsum BoardCarpet and Tile

Window Types: Interior Doors:
Single-hung Hollow core

Items

7.0 Ceilings

Comments: Inspected

7.1 Walls

Comments: Inspected

7.2 Floors

Comments: Inspected

7.3 Steps, Stairways, Balconies and Railings

Comments: Not Present

7.4 Counters and Cabinets (representative number)

Comments: Inspected

7.5 Doors (representative number)

Comments: Repair or Replace

Rated repair or replace due to bi-fold doors missing at front bedroom.

7.6 Windows (representative number)

Comments: Inspected

7.7 Slider doors

Comments: Inspected

Section Photos



7.5 Item 1(Picture)

1782 S W Advana St. Page 23 of 40

The interior of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection did not involve moving furniture and inspecting behind furniture, area rugs or areas obstructed from view. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 24 of 40

8. Foundation / Slab

The Home Inspector shall observe structural components including foundations, floors, walls, columns or piers, ceilings and roof. The home inspector shall describe the type of Foundation, floor structure, wall structure, columns or piers, ceiling structure, roof structure. The home inspector shall: Probe structural components where deterioration is suspected; Enter under floor crawl spaces, basements, and attic spaces except when access is obstructed, when entry could damage the property, or when dangerous or adverse situations are suspected; Report the methods used to observe under floor crawl spaces and attics; and Report signs of abnormal or harmful water penetration into the building or signs of abnormal or harmful condensation on building components. The home inspector is not required to: Enter any area or perform any procedure that may damage the property or its components or be dangerous to or adversely effect the health of the home inspector or other persons.

Styles & Materials

Floor Slab description: Floor Structure: Special Limitations:

Main portion of house Slab Completely covered by floor coverings

Items

8.0 Walls (Structural)

Comments: Not Inspected

8.1 Floors (Structural)

Comments: Not Inspected

8.2 Ceilings (Structural)

Comments: Inspected

The structure of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 25 of 40

9. Electrical System

The home inspector shall observe: Service entrance conductors; Service equipment, grounding equipment, main over current device, and main and distribution panels; Amperage and voltage ratings of the service; Branch circuit conductors, their over current devices, and the compatibility of their ampacities and voltages; The operation of a representative number of installed ceiling fans, lighting fixtures, switches and receptacles located inside the house, garage, and on the dwelling's exterior walls; The polarity and grounding of all receptacles within six feet of interior plumbing fixtures, and all receptacles in the garage or carport, and on the exterior of inspected structures; The operation of ground fault circuit interrupters; and Smoke detectors. The home inspector shall describe: Service amperage and voltage; Service entry conductor materials; Service type as being overhead or underground; and Location of main and distribution panels. The home inspector shall report any observed aluminum branch circuit wiring. The home inspector shall report on presence or absence of smoke detectors, and operate their test function, if accessible, except when detectors are part of a central system. The home inspector is not required to: Insert any tool, probe, or testing device inside the panels; Test or operate any over current device except ground fault circuit interrupters; Dismantle any electrical device or control other than to remove the covers of the main and auxiliary distribution panels; or Observe: Low voltage systems; Security system devices, heat detectors, or carbon monoxide detectors; Telephone, security, cable TV, intercoms, or other ancillary wiring that is not a part of the primary electrical distribution system; or Built-in vacuum equipment.

Styles & Materials

House Service: Service Panel: Distribution Panel:

Overhead Circuit Breaker Circuit Breaker 120/240 Volts: 200 Amps 200 Amps 200 Amps

Aluminum Exterior No Main Disconnect

200 Amps Garage

Type Circuits/ wireing: Circuit Interupters:

Copper At Recepticles

Copper Three Noted in Panel

Non-Metalic Cable sheath

Items

9.0 Service panel

Comments: Inspected
9.1 Distribution panel

Comments: Inspected

9.2 Operation of GFCI (Ground Fault Circuit Interrupters)

Comments: Inspected

9.3 Arc fault breakers

Comments: Inspected

9.4 Representative devices
Comments: Inspected

9.5 Service entrance

Comments: Inspected

1782 S W Advana St. Page 26 of 40



9.0 Item 1(Picture)




9.0 Item 2(Picture)




9.0 Item 3(Picture)



9.1 Item 1(Picture)

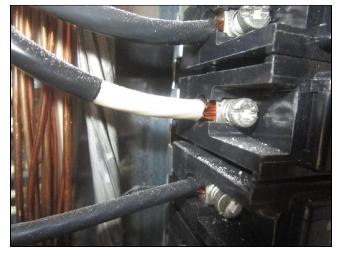


9.1 Item 2(Picture)

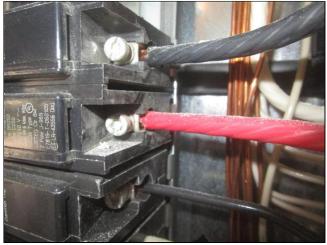

9.1 Item 3(Picture)

1782 S W Advana St. Page 27 of 40



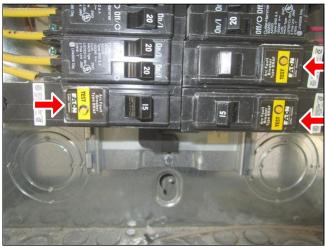

9.1 Item 4(Picture)



9.3 Item 1(Picture)



9.5 Item 1(Picture)

9.5 Item 2(Picture)

The electrical system of the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Outlets were not removed and the inspection was only visual. Any outlet not accessible (behind the refrigerator for example) was not inspected or accessible. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 28 of 40

10. Cooling System

The home inspector shall observe permanently installed heating and cooling systems including: Heating equipment; Cooling Equipment that is central to home; Normal operating controls; Automatic safety controls; Chimneys, flues, and vents, where readily visible; Solid fuel heating devices; Heat distribution systems including fans, pumps, ducts and piping, with supports, insulation, air filters, registers, radiators, fan coil units, convectors; and the presence of an installed heat source in each room. The home inspector shall describe: Energy source; and Heating equipment and distribution type. The home inspector shall operate the systems using normal operating controls. The home inspector shall open readily openable access panels provided by the manufacturer or installer for routine homeowner maintenance. The home inspector is not required to: Operate heating systems when weather conditions or other circumstances may cause equipment damage; Operate automatic safety controls; Ignite or extinguish solid fuel fires; or Observe: The interior of flues; Fireplace insert flue connections; Humidifiers; Electronic air filters; or The uniformity or adequacy of heat supply to the various rooms.

Styles & Materials

Type System:Brand:Est. Age:Electric Central Air ConditioningLennox8 Years

Design Life: Air Handler Location: Primary Distribution Method:

10 to 15 Years Garage Ducted System w/ room supply vents

Size:

4 Ton

Items

10.0 Cooling differential test

Comments: Inspected

The ambient air test was performed by using thermometers on the air handler of Air conditioner to determine if the difference in temperatures of the supply and return air are between 14 degrees and 22 degrees which indicates that the unit is cooling as intended. The supply air temperature on your system read 77 degrees, and the return air temperature was 62 degrees. This indicates Unit is cooling properly at this time..

10.1 Outdoor Unit

Comments: Inspected

10.2 Indoor Unit

Comments: Inspected

10.3 Condensate system

Comments: Inspected

10.4 Distribution Systems (including; duct work and vents)

Comments: Inspected

10.5 Thermostat controle device

Comments: Inspected

1782 S W Advana St. Page 29 of 40



10.0 Item 1(Picture)



10.0 Item 2(Picture)




10.1 Item 1(Picture)




10.2 Item 1(Picture)

1782 S W Advana St. Page 30 of 40

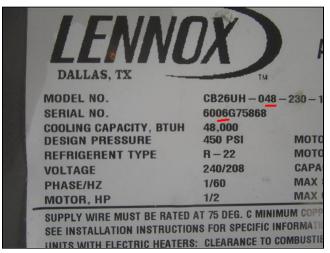

10.2 Item 2(Picture)

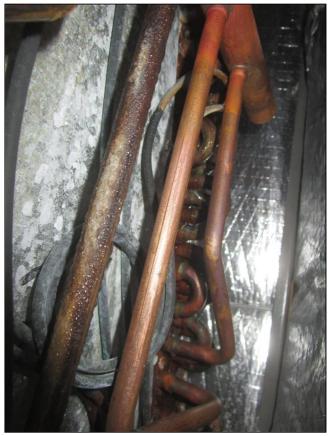

10.2 Item 3(Picture)



10.3 Item 1(Picture)

The heating and cooling system of this home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. The inspection is not meant to be technically exhaustive. The inspection does not involve removal and inspection behind service door or dismantling that would otherwise reveal something only a licensed heat contractor would discover. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 31 of 40

11. Plumbing System

The home inspector shall observe: Interior water supply and distribution system, including: piping materials, supports, and insulation; fixtures and faucets; functional flow; leaks; and cross connections; Interior drain, waste, and vent system, including: traps; drain, waste, and vent piping; piping supports and pipe insulation; leaks; and functional drainage; Hot water systems including: water heating equipment; normal operating controls; automatic safety controls; and chimneys, flues, and vents; Fuel storage and distribution systems including: interior fuel storage equipment, supply piping, venting, and supports; leaks; and Sump pumps. The home inspector shall describe: Water supply and distribution piping materials; Drain, waste, and vent piping materials; Water heating equipment; and Location of main water supply shutoff device. The home inspector shall operate all plumbing fixtures, including their faucets and all exterior faucets attached to the house, except where the flow end of the faucet is connected to an appliance. The home inspector is not required to: State the effectiveness of anti-siphon devices; Determine whether water supply and waste disposal systems are public or private; Operate automatic safety controls; Operate any valve except water closet flush valves, fixture faucets, and hose faucets; Observe: Water conditioning systems; Fire and lawn sprinkler systems; On-site water supply quantity and quality; On-site waste disposal systems; Foundation irrigation systems; Spas, except as to functional flow and functional drainage; Swimming pools; Solar water heating equipment; or Observe the system for proper sizing, design, or use of proper materials.

Styles & Materials

Water Source: Plumbing Water Supply (into home): Plumbing Water Distribution (inside home):

Public Copper Not visible

Washer Drain Size:

1 1/2" Diameter (undersized)

Items

11.0 Main Water Shut-off Device (Describe location)

Comments: Inspected

11.1 Exterior faucets

Comments: Inspected

11.2 Plumbing Drain, Waste and Vent Systems

Comments: Inspected

11.3 City Maserator

Comments: Inspected

11.4 Laundry equipment

Comments: Not Present

11.5 Laundry hook ups

Comments: Inspected


11.6 Laundry sink

Comments: Inspected

1782 S W Advana St. Page 32 of 40



11.0 Item 1(Picture)

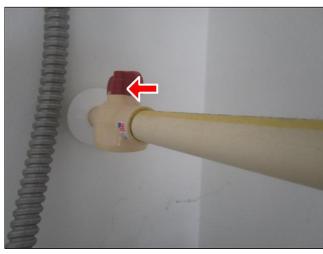

11.0 Item 2(Picture)



11.1 Item 1(Picture)



11.3 Item 1(Picture)

1782 S W Advana St. Page 33 of 40





11.3 Item 2(Picture)

11.5 Item 1(Picture)



11.6 Item 1(Picture)

The plumbing in the home was inspected and reported on with the above information. While the inspector makes every effort to find all areas of concern, some areas can go unnoticed. Washing machine drain line for example cannot be checked for leaks or the ability to handle the volume during drain cycle. Older homes with galvanized supply lines or cast iron drain lines can be obstructed and barely working during an inspection but then fails under heavy use. If the water is turned off or not used for periods of time (like a vacant home waiting for closing) rust or deposits within the pipes can further clog the piping system. Please be aware that the inspector has your best interest in mind. Any repair items mentioned in this report should be considered before purchase. It is recommended that qualified contractors be used in your further inspection or repair issues as it relates to the comments in this inspection report.

1782 S W Advana St. Page 34 of 40

Garage

12. Hot Water Supply

Styles & Materials

Hot Water Supply: Brand: Energy Source:

Tank Type Unit Ruud Electric

Est. Age: Design Life: Unit Location:

8 Years 10 to 15 Years Est. Capacity:

Items

12.0 Water Heater

50 Gallons + -

Comments: Inspected

12.1 Main water valve

Comments: Inspected

12.2 Expansion tank

Comments: Inspected

12.3 TPR valve

Comments: Inspected

12.4 Drip Pan

Comments: Inspected

12.5 Barrier post

Comments: Inspected


1782 S W Advana St. Page 35 of 40



12.0 Item 1(Picture)



12.0 Item 2(Picture)

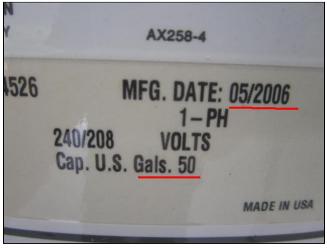

12.0 Item 3(Picture)



12.0 Item 4(Picture)



12.0 Item 5(Picture)



12.3 Item 1(Picture)

1782 S W Advana St. Page 36 of 40

General Summary



Home Inspection Pros T C Inc.

4253 S W Callicoe St. Port Saint Lucie, FL, 34953 772 267-1938

> Customer Jose Mejia

Address

1782 S W Advana St. Port Saint Lucie FL 34953

The following items or discoveries indicate that these systems or components **do not function as intended** or **adversely affects the habitability of the dwelling;** or **warrants further investigation by a specialist,** or **requires subsequent observation.** This summary shall not contain recommendations for routine upkeep of a system or component to keep it in proper functioning condition or recommendations to upgrade or enhance the function or efficiency of the home. This Summary is not the entire report. The complete report may include additional information of concern to the customer. It is recommended that the customer read the complete report.

1. Roofing

1.5 Roof Drainage Systems

Repair or Replace

Rated repair or replace due to extensions needed to move water away from house footings. Recommend qualified person repair as needed.

2. Exterior



2.2 Doors (Exterior)

Repair or Replace

Rated repair or replace due to rear bath door trim needs to be sealed and repaired due to water damage. Recommend qualified person repair as needed.

2.3 Windows

1782 S W Advana St. Page 37 of 40

2. Exterior



Repair or Replace

Seal around windows to prevent water penetrating around window frames. Recommend qualified person repair as needed.

2.6 Porch(s)

Inspected, Repair or Replace

Rated repair or replace due to ceiling of rear porch has area that needs patching. Recommend qualified person repair as needed.

5. Bathrooms

5.3 Bathtub

Repair or Replace

Tub stopper missing. Recommend qualified person repair as needed.

6. Kitchen

6.0 Sink

Repair or Replace

Rated repair or replace due to disposal is not functioning and is stopping drainage of left sink. Recommend qualified person replace as needed.

7. Interiors

7.5 Doors (representative number)

Repair or Replace

Rated repair or replace due to bi-fold doors missing at front bedroom.

Home inspectors are not required to report on the following: Life expectancy of any component or system; The causes of the need for a repair; The methods, materials, and costs of corrections; The suitability of the property for any specialized use; Compliance or non-compliance with codes, ordinances, statutes, regulatory requirements or restrictions; The market value of the property or its marketability; The advisability or inadvisability of purchase of the property; Any component or system that was not observed; The presence or absence of pests such as wood damaging organisms, rodents, or insects; or Cosmetic items, underground items, or items not permanently installed. Home inspectors are not required to: Offer warranties or guarantees of any kind; Calculate the strength, adequacy, or efficiency of any system or component; Enter any area or perform any procedure that may damage the property or its components or be dangerous to the home inspector or other persons; Operate any system or component that is shut down or otherwise inoperable; Operate any system or component that does not respond to normal operating controls; Disturb insulation, move personal items, panels, furniture, equipment, plant life, soil, snow, ice, or debris that obstructs access or visibility; Determine the presence or absence of any suspected adverse environmental condition or hazardous substance, including but not limited to mold, toxins, carcinogens, noise, contaminants in the building or in soil, water, and air; Determine the effectiveness of any system installed to control or remove suspected hazardous substances; Predict future condition, including but not limited to failure of components; Since this report is provided for the specific benefit of the customer(s), secondary readers of this information should hire a licensed inspector to perform an inspection to meet their specific needs and to obtain current information concerning this property.

Prepared Using HomeGauge http://www.HomeGauge.com : Licensed To Roger Bayless

1782 S W Advana St. Page 38 of 40



INVOICE

Home Inspection Pros T C Inc. 4253 S W Callicoe St. Port Saint Lucie, FL, 34953 772 267-1938 Inspected By: Roger Bayless

Inspection Date: 9/22/2014 Report ID: 0147

Customer Info:	Inspection Property:
Jose Mejia	1782 S W Advana St. Port Saint Lucie FL 34953
Customer's Real Estate Professional: Vicky Valdez	

Inspection Fee:

Service	Price	Amount	Sub-Total
Sq Ft 1,000 - 2,000	225.00	1	225.00
termite insp.	100.00	1	100.00
extra discount	-25.00	1	-25.00

Tax \$0.00

Total Price \$300.00

Payment Method: Check Payment Status: Paid

Note:

1782 S W Advana St. Page 39 of 40



Home Inspection Pros T C Inc.

Roger Bayless

4253 S W Callicoe St. Port Saint Lucie, FL, 34953 772 267-1938



1782 S W Advana St. Page 40 of 40